



PISTOL POWDER MEASURE



Your new Pacific Pistol Powder Measure utilizes a unique design concept to provide the accuracy of a fixed powder measure and the convenience of a variable measure, by means of interchangeable powder bushings for various powder charges.

The powder measure is designed with an offset powder drop tube that has a standard 7/8 x 14 thread and lock ring to hold it in the stand.

MOUNTING THE PISTOL POWDER MEASURE

Secure the mounting bracket to a solid, vibration-free bench or table with four 1/4" bolts or screws, conveniently located to fit your own mounting and reloading requirements. (NOTE: Vibrations tend to settle powder unevenly with any measure and may cause erratic powder charges.)

After mount is secure, place measure in hole of stand so that powder drop tube is to the left hand side of the mount. Turn lock ring over the powder tube and secure.

OPERATING PROCEDURES

1. Determine the load you are to use from your Hornady Handbook of Cartridge Reloading or other reliable source and select bushing from chart that throws this desired charge. (There are twenty-two bushings presently available from your dealer.)
2. Place proper bushing in hole in center of charge bar and carefully insert charge bar into measure body after removing one charge bar stop. After charge bar is in measure body, replace charge bar stop, and push bar all the way to the left.
3. Place proper powder in hopper and throw two or three charges to settle powder, before throwing powder into case. When bar is pushed all the way to the right, the charge bushing picks up the proper charge, and the charge is thrown in the cartridge case when the bar is thrown to the left.
4. When through using measure, always return remaining powder to original container.

IMPORTANT: Place primed and sized case into the cone of the powder drop tube and throw each charge of powder with a steady movement, fully to each stop, with sufficient force to keep the powder packed tight enough in the bushing cavity to throw uniform charge each time. Keep measure at least half full of powder for uniformity.

NOTE: The charge bar may not move freely if powder dust is allowed to collect on the bar. Do not use oil on the bar. Wipe occasionally with a clean soft cloth.


PACIFIC PISTOL POWDER MEASURE

Stock No.	Bushing Size No.	Dupont 700X	Dupont 4227	Dupont SR7625	Dupont SR756	Dupont PB	Hercules Bullseye	Hercules 2409	Hercules Red Dot	Hercules Unique	Hercules Hero	Hercules Blue Dot	Hodges HP28	Hodges Trap 100	Hodges HS-5	Hodges HS-4	Hodges HS-7	Hodges H-110	Hodges H-4227	Norma R1	Norma R123	Winchester 231	Winchester 296	Winchester 630	Winchester 660
290006	1	2.0	NR	NR	NR	NR	2.6	NR	NR	NR	NR	NR	3.0	2.3	4.1	3.9	4.0	4.2	3.6	1.9	NR	3.0	NR	4.0	NR
290007	2	2.1	NR	NR	NR	NR	2.8	NR	NR	NR	NR	NR	3.2	2.5	4.5	4.2	4.4	4.5	3.9	2.0	NR	3.3	NR	4.2	NR
290008	3	2.3	NR	NR	NR	NR	3.0	NR	NR	NR	NR	NR	3.6	2.8	5.0	4.6	4.8	5.0	4.3	2.3	NR	3.6	NR	4.9	NR
290009	4	2.7	NR	NR	NR	NR	3.4	NR	NR	NR	NR	NR	4.0	3.1	5.6	5.2	5.5	5.6	4.9	2.6	NR	4.1	NR	5.6	NR
290010	5	2.9	NR	3.1	NR	2.9	3.7	NR	NR	NR	NR	NR	4.3	3.4	6.1	5.8	5.0	6.1	5.3	2.9	NR	4.5	NR	6.1	NR
290011	6	3.0	NR	3.5	NR	3.1	3.9	NR	NR	NR	NR	NR	4.5	3.6	6.4	6.0	6.2	6.4	5.5	3.1	NR	4.6	NR	6.3	NR
290012	7	3.2	NR	3.8	NR	3.2	4.1	NR	NR	NR	NR	NR	4.8	3.9	6.9	6.3	6.7	6.9	6.0	3.2	NR	4.8	NR	6.5	NR
290013	8	3.5	NR	4.1	NR	3.3	4.4	NR	NR	NR	NR	NR	5.0	4.0	7.4	7.0	7.3	7.4	6.5	3.7	NR	5.3	NR	7.2	NR
290014	9	3.7	NR	4.2	3.7	3.4	4.5	NR	NR	NR	NR	NR	5.2	4.2	7.7	7.4	7.6	7.7	6.7	3.8	NR	5.5	NR	7.5	NR
290015	10	4.0	7.3	5.0	4.5	4.0	5.1	NR	NR	NR	NR	NR	6.1	4.9	8.5	7.9	8.4	8.6	7.5	4.3	NR	6.3	NR	8.4	NR
290016	11	4.3	7.5	5.1	4.6	4.6	5.2	7.3	NR	NR	NR	NR	4.5	4.6	8.4	8.2	8.8	9.0	7.7	4.5	NR	6.4	NR	8.7	8.8
290017	12	4.6	8.0	5.5	4.8	4.8	6.8	7.9	2.2	5.8	4.8	NR	6.8	5.3	9.4	9.0	9.3	9.5	8.2	4.8	NR	6.9	NR	9.2	9.5
290018	13	5.0	8.8	6.0	5.6	5.3	NR	8.7	3.3	6.5	5.3	NR	7.6	5.8	10.3	9.7	10.1	10.4	9.0	5.3	NR	7.6	10.3	10.2	10.5
290019	14	5.5	9.4	6.4	6.0	5.8	NR	9.3	3.5	6.8	5.7	NR	8.1	6.4	11.1	10.5	11.0	11.1	9.6	5.7	NR	8.1	11.0	10.8	11.2
290020	15	5.8	9.9	6.8	6.4	6.0	NR	9.8	3.7	7.2	5.9	NR	8.5	6.7	11.6	11.1	11.6	11.8	10.2	6.0	NR	8.5	11.8	11.5	11.9
290021	16	6.1	10.3	7.1	6.7	6.4	NR	10.3	4.2	7.5	6.2	NR	8.9	7.0	12.4	11.5	12.3	12.4	10.7	NR	NR	8.9	12.2	12.2	12.6
290022	17	6.5	11.5	7.9	7.6	7.0	NR	11.4	4.8	8.4	6.6	9.7	9.6	7.7	13.7	12.8	13.5	13.7	11.8	NR	NR	9.9	12.6	13.4	13.8
290023	18	NR	12.1	8.1	7.8	7.3	NR	12.0	5.3	8.7	7.3	10.1	10.2	8.0	14.1	13.3	13.9	14.0	12.2	NR	10.1	NR	14.0	13.8	14.3
290024	19	NR	12.3	8.8	8.3	7.8	NR	12.7	6.0	9.2	7.7	10.8	10.6	8.4	15.0	13.9	14.6	14.9	12.9	NR	10.8	NR	14.7	14.8	15.1
290025	20	NR	13.4	9.1	8.8	8.0	NR	13.4	6.4	9.7	8.1	11.4	11.4	8.8	15.7	14.9	15.6	15.6	13.6	NR	11.5	NR	15.6	15.5	16.0
290026	21	NR	14.7	9.9	9.7	8.9	NR	14.7	7.2	10.6	8.7	12.5	12.6	9.7	17.6	16.2	17.1	17.5	15.1	NR	12.5	NR	17.1	16.8	17.5
290027	22	NR	15.7	10.4	10.2	9.4	NR	15.5	7.5	11.4	9.5	13.2	13.2	10.4	18.3	17.0	17.7	17.9	15.9	NR	13.2	NR	17.9	18.0	18.3

NOTE: All Powder Designated in Grains. NR = Not Recommended.

CHANGING BUSHINGS

To change bushings while powder is in hopper and without removing measure from stand, turn charge bar stop (left hand side) out and push bar all the way to the right until the bushing is exposed. One charge will drop in this process but bushing may be removed and replaced without powder spilling.

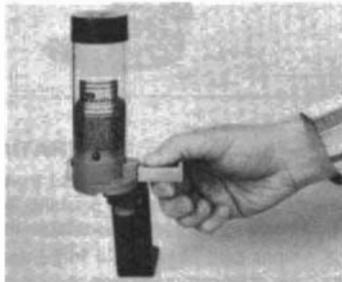

PISTOL POWDER BUSHINGS

Extra bushings to make your measure more versatile. Specify from chart at left and order by number from your dealer \$2.00

NOTICE: Prices and/or specifications are subject to change without notice. Discontinued products may or may not have replacement parts available. Call for availability 800-338-3220.

Pacific
Div. of Hornady

RELOADING TOOLS AND ACCESSORIES
Pacific Tool Company, Box 2048, Grand Island, Nebraska 68801

Hornady Pacific Frontier

Form No.
PIPPM-280-5M